

Date: Monday, 15/12/2008 9:26:47 AM
 User: Julie Dawson







Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	MID TUBE ASSEMBLY
Job Number :	44042		
Estimate Number :	10469		
P.O. Number :		Part Number :	D3391023
This Issue :	15/12/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D3391 REV H
First Issue :	12/12/2008	Project Number :	N/A
Previous Run :	43170	Drawing Revision :	H
		Material :	
Written By :		Due Date :	19/12/2008
Checked & Approved By :		Qty:	1 Um: Each
Comment :	Est. A 05.10.20 New Issue KJ/EC Est. B 06.02.10 ECN773 dwg rev.D EC est C 07.03.20 rev F dwg EC est D 07.03.28 re-format EC est E 07.10.31 ecn 1053P EC Est Rev:F ECN 1056 07-11-13 DD verified by: EC Est Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC Est Rev:H 08-09-10 revH as per dwg DD verified by:EC Est Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :								
1.0	D25001100	Skidtube Extrusion								
<div><div></div><div></div></div>										
Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s) SKIDTUBE EXTRUSION Pick: <table><tr><th>Qty</th><th>Part Number</th><th>Description</th><th>Batch</th></tr><tr><td>1</td><td>D2500-1-100</td><td>Extrusion</td><td><u>37065</u> SL 8-12-16</td></tr></table>			Qty	Part Number	Description	Batch	1	D2500-1-100	Extrusion	<u>37065</u> SL 8-12-16
Qty	Part Number	Description	Batch							
1	D2500-1-100	Extrusion	<u>37065</u> SL 8-12-16							
2.0	D3391021	Fwd Tube Assembly								
<div><div></div><div></div></div>										
Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s) Fwd Tube Assembly Batch: <u>B44041E</u> Pm 09-01-15										
3.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1								
<div><div></div><div></div></div>										
Comment: LANDING GEAR RESOURCE 1 1-Cut tube to finish length as per Dwg D3391 2-Identify as D3391-023 3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as										

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 15/12/2008 9:26:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 44042

Part Number: D3391023

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J", do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

11-Open .375" holes to .438" ***do not open fwd saddle holes***

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

15- Locating from two fwd wearplate holes drilol remaining 6 wearplte holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open-12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

4.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 Oct 15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 15/12/2008 9:26:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 44042

Part Number: D3391023

Job Number:



Seq. #: Machine Or Operation: Description :

5.0 HAND FINISHING1 HAND FINISHING RESOURCE #1



Handwritten: 09-01-15



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

6.0 QC3 INSPECT POWDER COAT/CHEMICAL CONVERSION



Handwritten: 09-1-16



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

7.0 D33891 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEB

Pick:

Qty	Part Number	Description	Batch
1	D3389-1	Web	<i>Handwritten: 1343191</i>
A/R		Sikaflex-241/-291	<i>Handwritten: M109883</i>
		Sikaflex expire date:	<i>Handwritten: 09-07-11</i>

Handwritten: 09-01-16

Start: *Handwritten: 09-01-16* Time: *Handwritten: 8:00*

Finish: *Handwritten: 9/1/19* Time: *Handwritten: 1:05 PM*

8.0 SKIDTUBES 1 SKIDTUBESS RESOURCE 1




Comment: LANDING GEAR RESOURCE 1

1-Open float bag holes as per dwg

2-C'sink float bag holes as per dwg

3- Prepare tube for welding

4-Bond web in place as per Dwg D3391 & QSI 015.
Adhere for 12 hours)

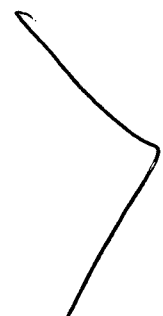

Handwritten: 09-01-16

9.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Handwritten: 09/01/19 (40)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 15/12/2008 9:26:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 44042

Part Number: D3391023

Job Number:



Seq. #: Machine Or Operation: Description :

10.0 D36811 Spacer



Comment: Qty.: 5.0000 Each(s)/Unit Total: 5.0000 Each(s)

SPACER

batch: *B41248* *BE 09-01-19*

11.0 SKIDTUBES 1 SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld crossbolt spacer as per dwg D3391 & QSI 004

2-grind weld flush

AIR M 109560

BE 09-01-19

9-1-20

12.0 QC10 VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 096021 *(X)*

13.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 096021 *(X)*

14.0 POWDER COATING POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

2:10 OF
320
2:50

M-H 09/01/30

(1X)

15.0 QC3 INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BR 09-02-03 *(X)*

16.0 D35911 Bushing



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)


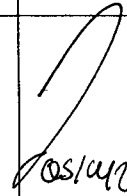
 

Bushing

B43172

RTO

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D3391-023 PAR #: NA Fault Category: Prod/Skdhbe NCR: Yes No DQA: 1 Date: 09/02/13
 Resolution: Re-work Disposition: Re-work QA: N/C Closed: 1 Date: 09/02/13

NCR: 44042		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
09-02-04 BR	2.0	ON WORK ORDER N1682A CHANGE BUSHING D3591-1 B 43172 R.C. insert striped during assembly so tube had to be pulled out and Bushing were damaged. Process.		change striped insert. touch up p/c with immo Paint.	BR 09-02-04 BR 09-02-04	S okada		S okada
				Reinstall D3591-1 B 43172 AS per Dwg.	BR 09-02-04	S okada		S okada

NOTE: Date & initial all entries

Date: Monday, 15/12/2008 9:26:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 44042

Part Number: D3391023

Job Number:



Seq. #: Machine Or Operation: Description :

17.0 SKIDTUBES 1 SKIDTUBESS RESOURCE 1



Comment: SKIDTUBESS RESOURCE 1

- 1- insert D3391-021 into D3391-23
- 2- insert T-pins into first and third fwd saddle holes
- 3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364
- 4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos
- 5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove DT9415
- 6- deburr, re-alodine and blow out chips
- 7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

BR 09-02-04

18.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 09/02/04 (X)

19.0 ALS41032130 Insert



Comment: Qty.: 22.0000 Each(s)/Unit Total: 22.0000 Each(s)

INSERT
batch: M105819
or equivalent
per QSI 017

(20)

BR 09-02-03

20.0 HAND FINISHING1 HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

BR 09-02-03

21.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 09/02/04 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 15/12/2008 9:26:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 44042

Part Number: D3391023

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

22.0

PACKAGING 1

PACKAGING RESOURCE #1



②

Comment: PACKAGING RESOURCE #1

Identify and Stock

Location:

JP 24682

9h/1p0

S9

23.0

QC21

FINAL INSPECTION/W/O RELEASE



09/02/11

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF
09-02-10


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

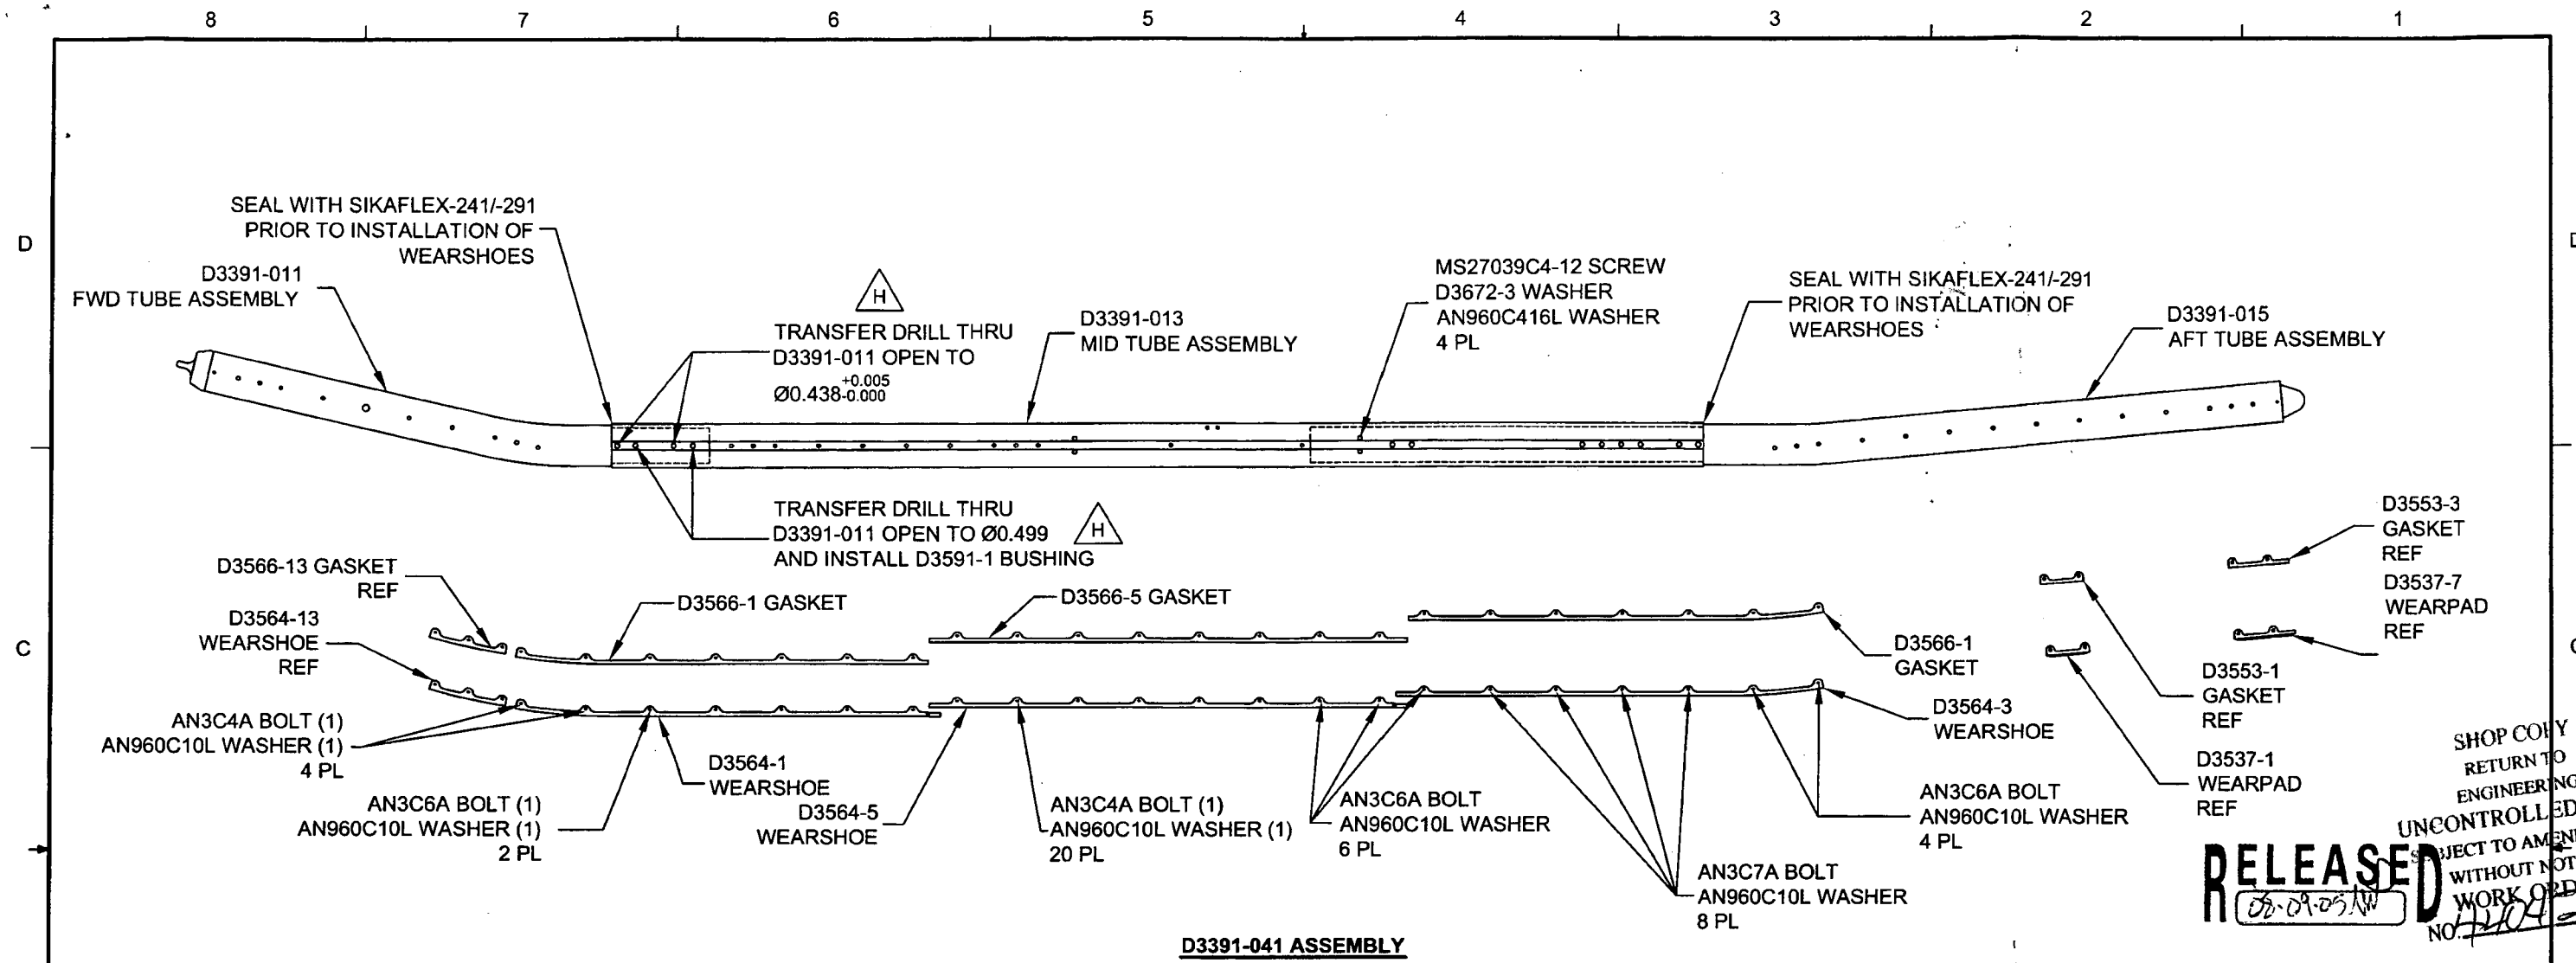

D3391-041 ASSEMBLY

RELEASED
02-09-2011

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42042


D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

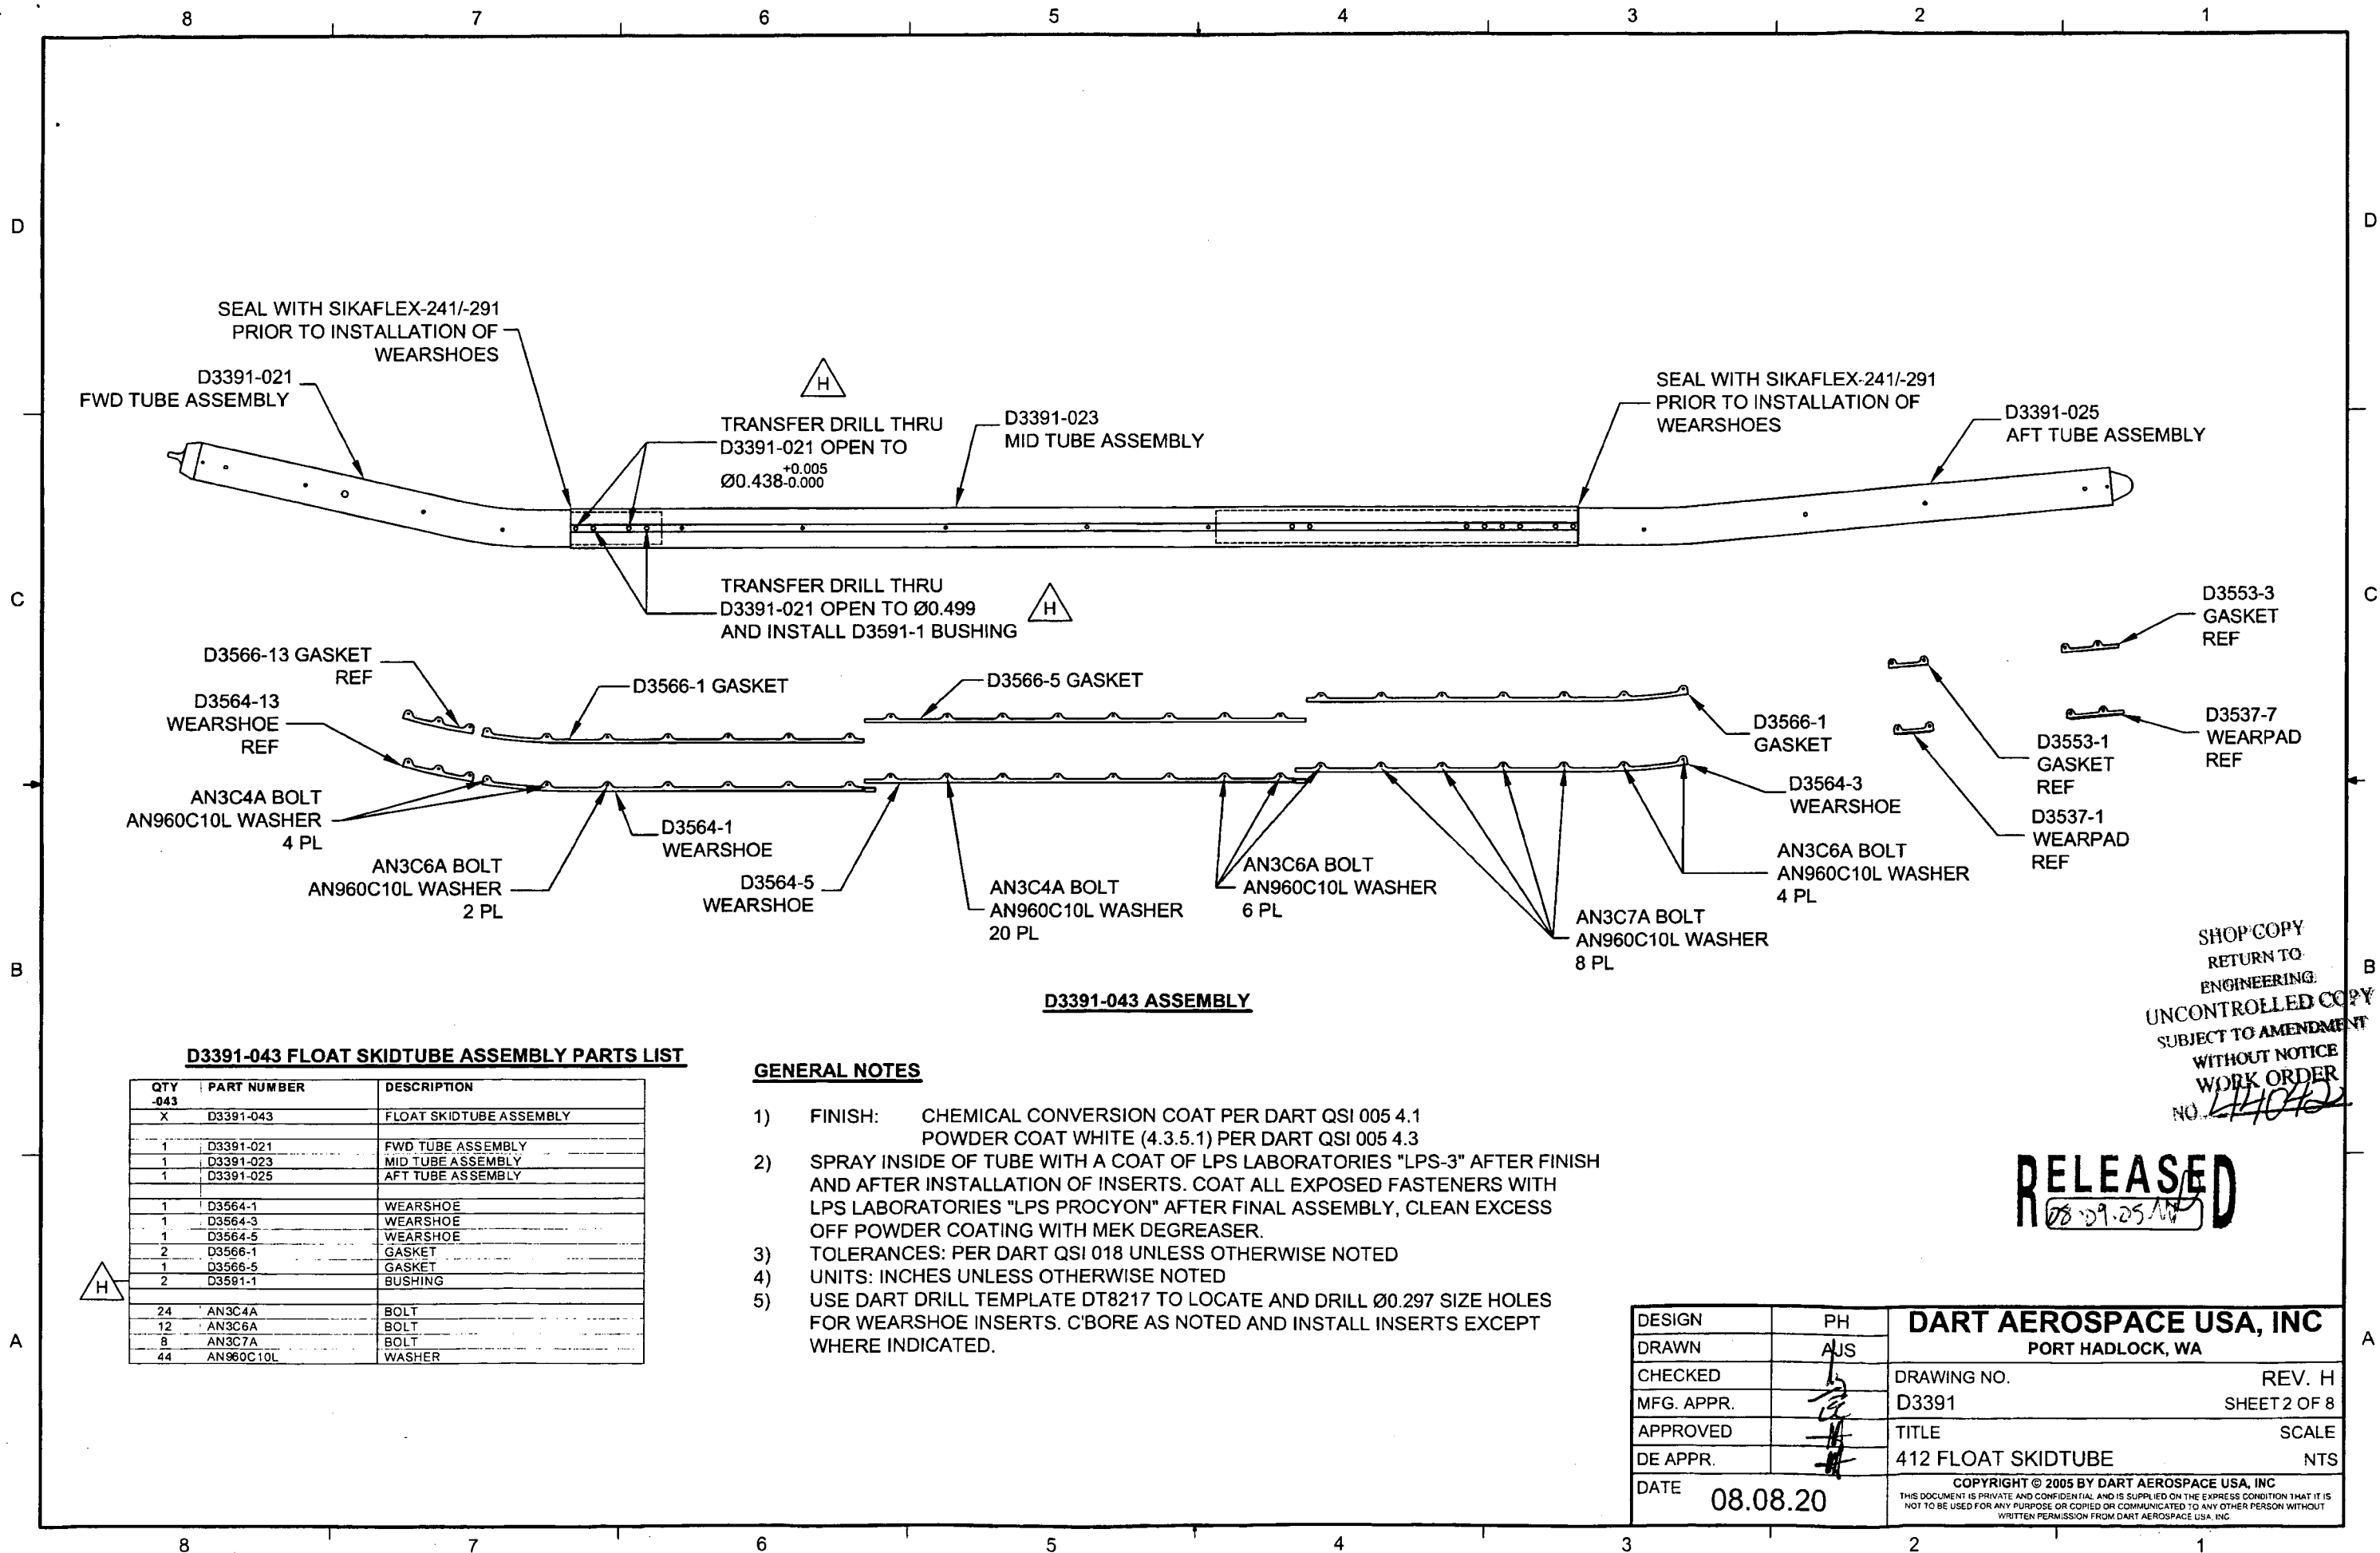


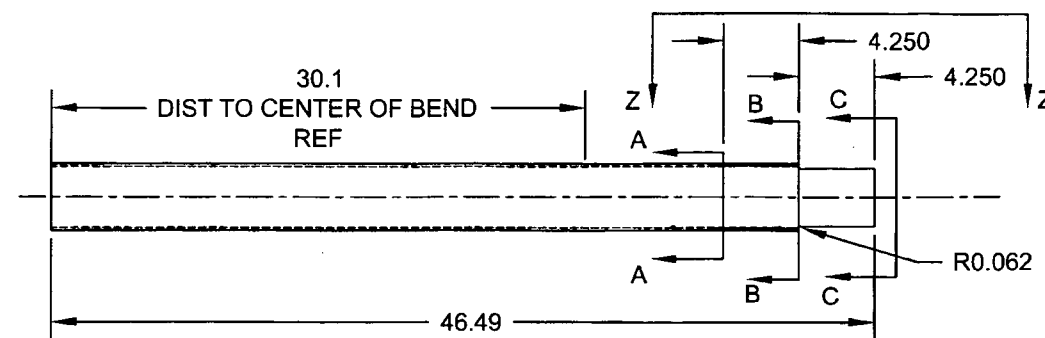


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

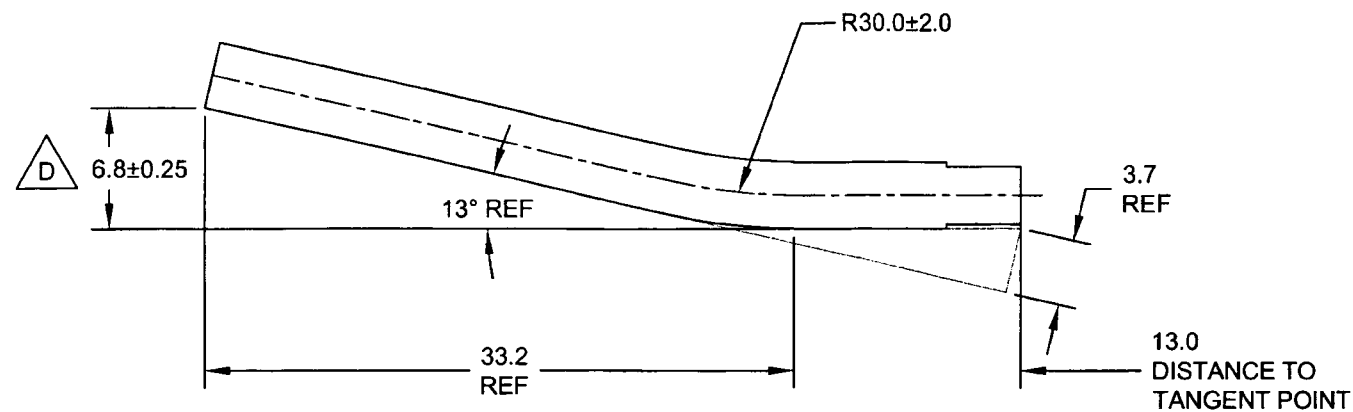


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

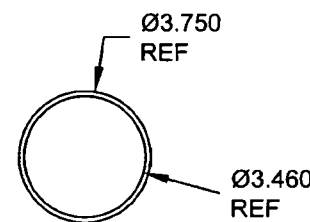


SECTION A-A
SCALE 2X

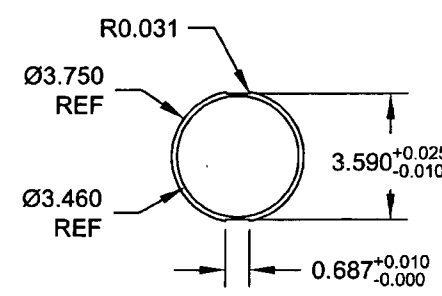

SECTION B-B
SCALE 2X

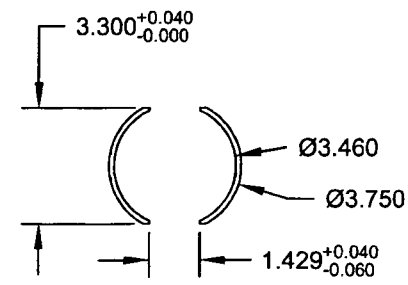

SECTION C-C
SCALE 2X

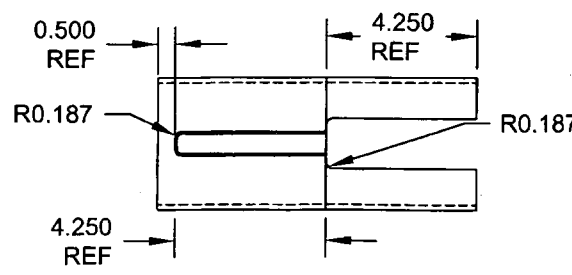



VIEW Z-Z
SCALE 2X

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 44042

RELEASED
8-9-05 AM


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

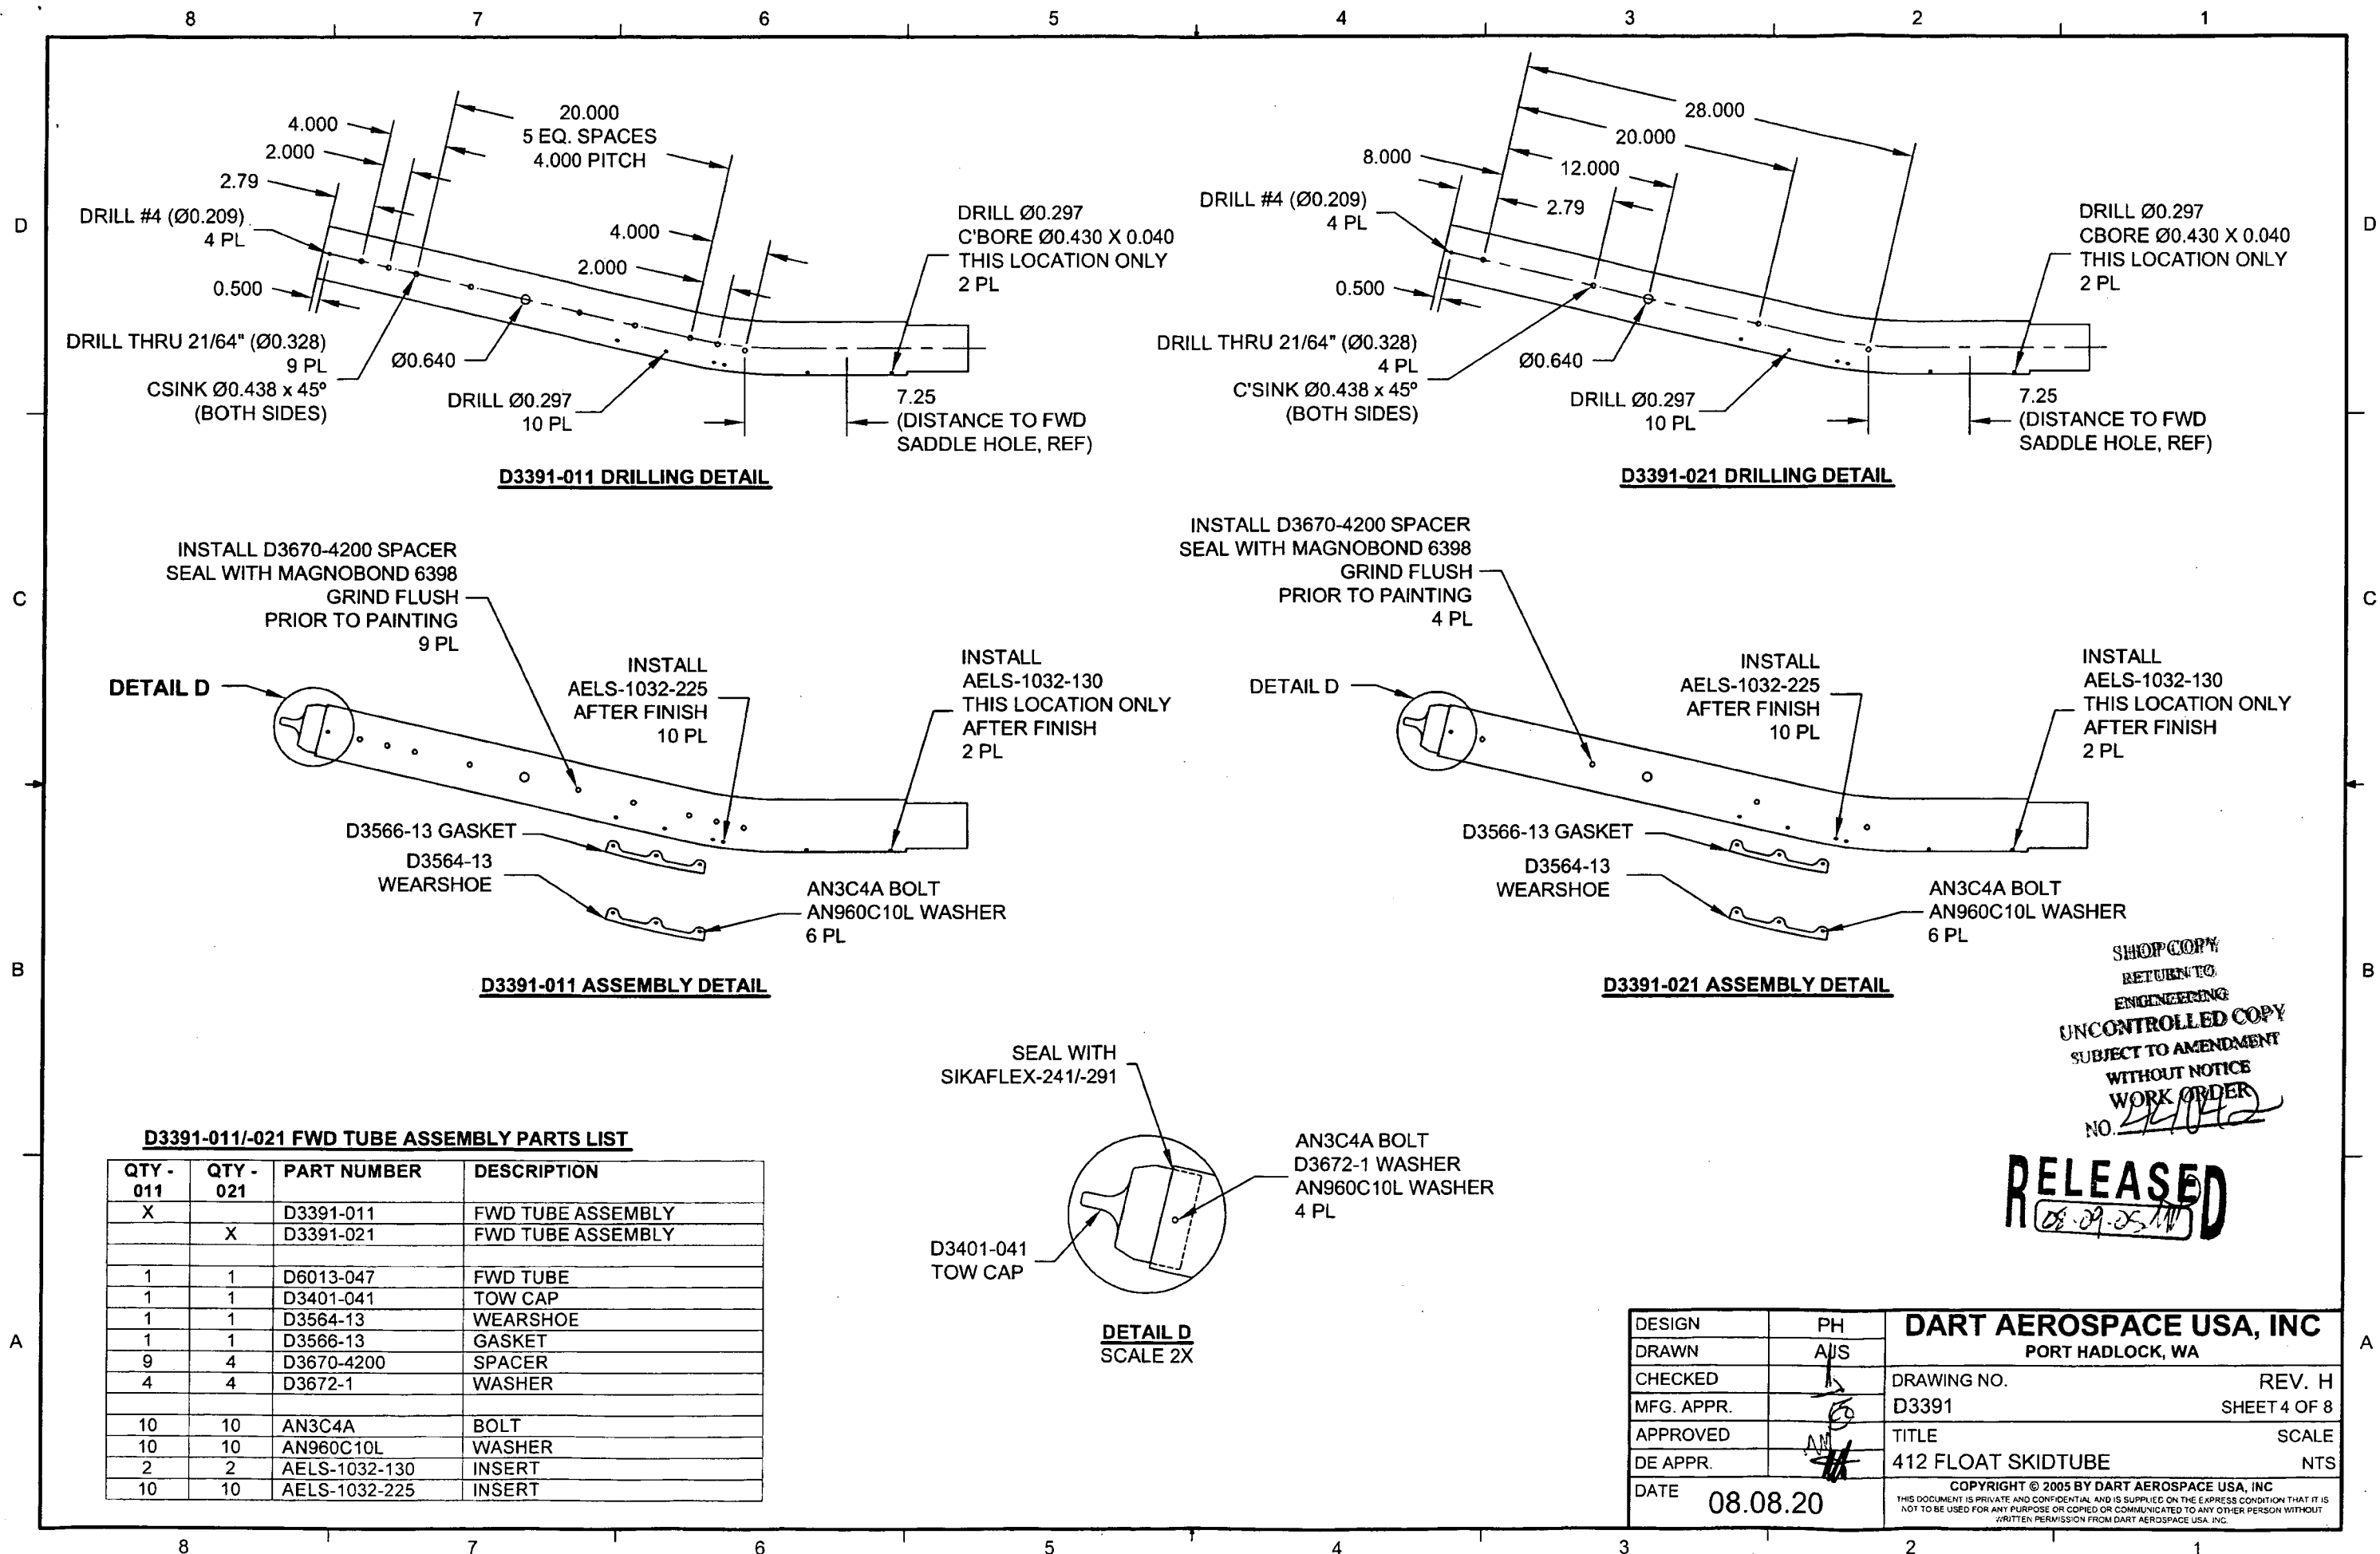

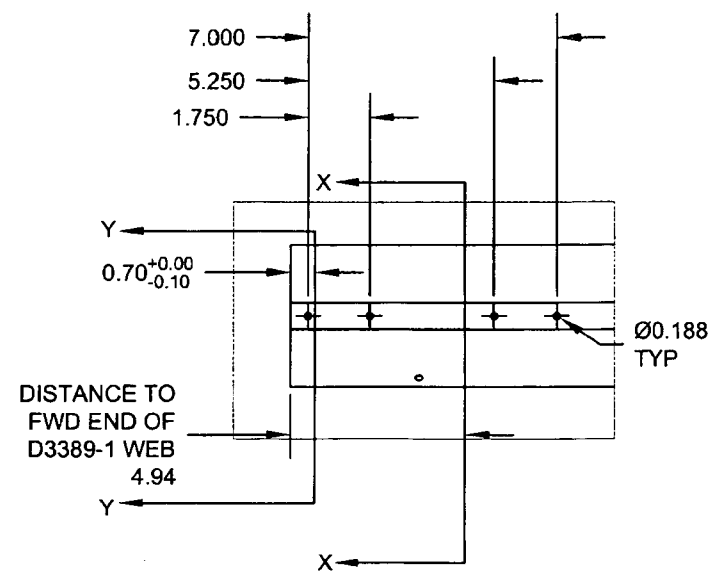


DETAIL J
SCALE 4X


DRILL THRU 21/64" (Ø0.328)
CSINK Ø0.438 X 45° (BOTH SIDES)
12 PL

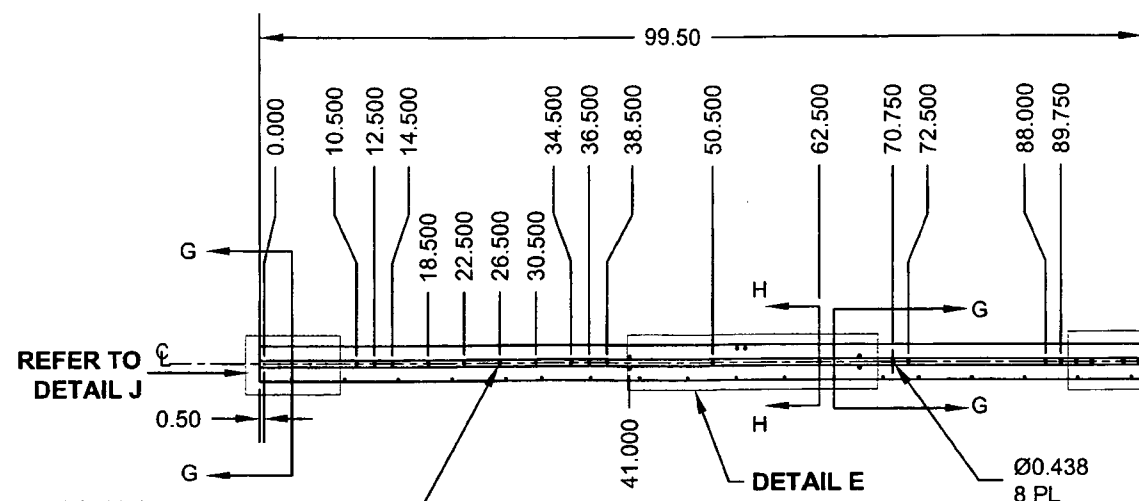


D3391-013 ASSEMBLY DETAIL

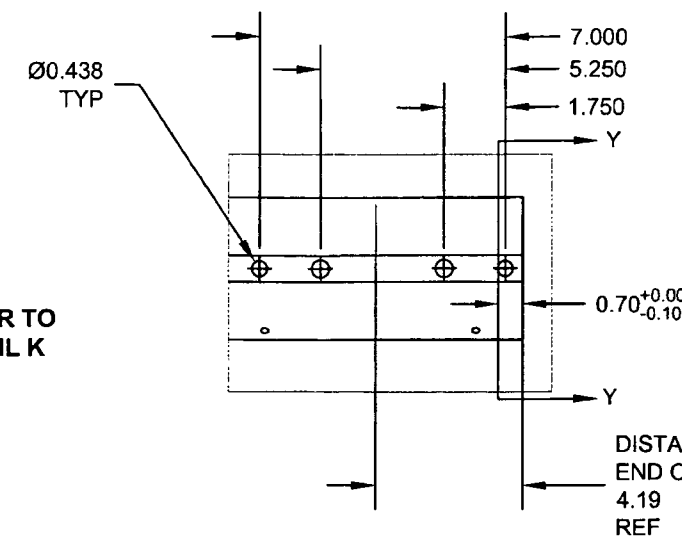


DETAIL K
SCALE 4X

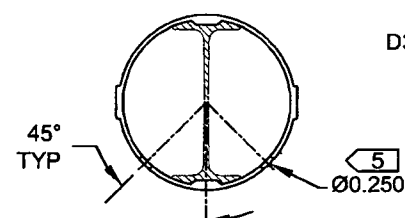


SECTION G-G
SCALE 5X

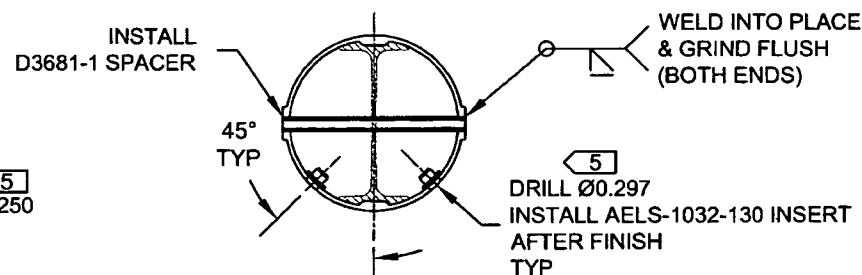

SECTION H-H
SCALE 5X

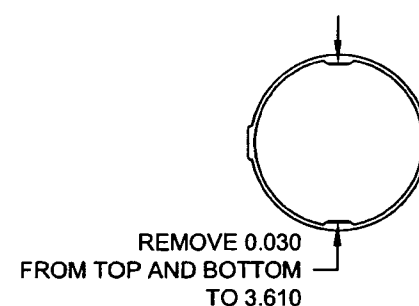


SECTION X-X
SCALE 5X

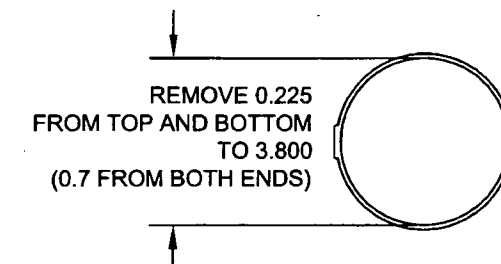


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST


QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

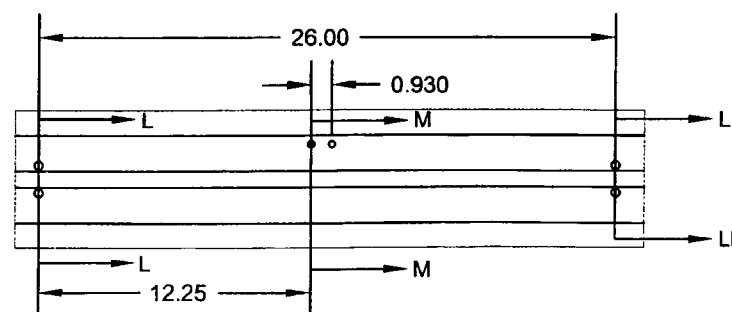

DETAIL E
SCALE NONE

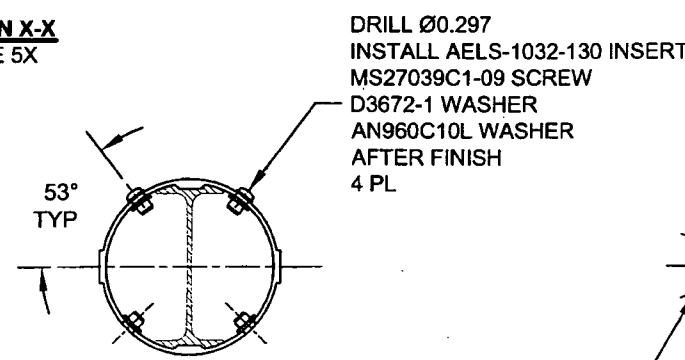


SECTION M-M
SCALE 5X

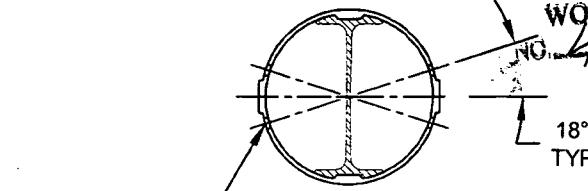

SECTION LL-LL
SCALE 5X

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
4 PL

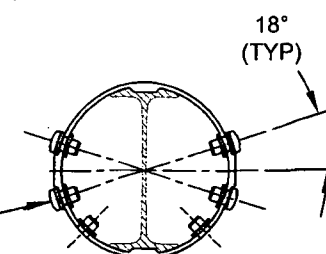

SECTION L-L
SCALE 5X



D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 44092

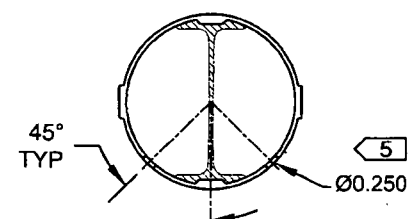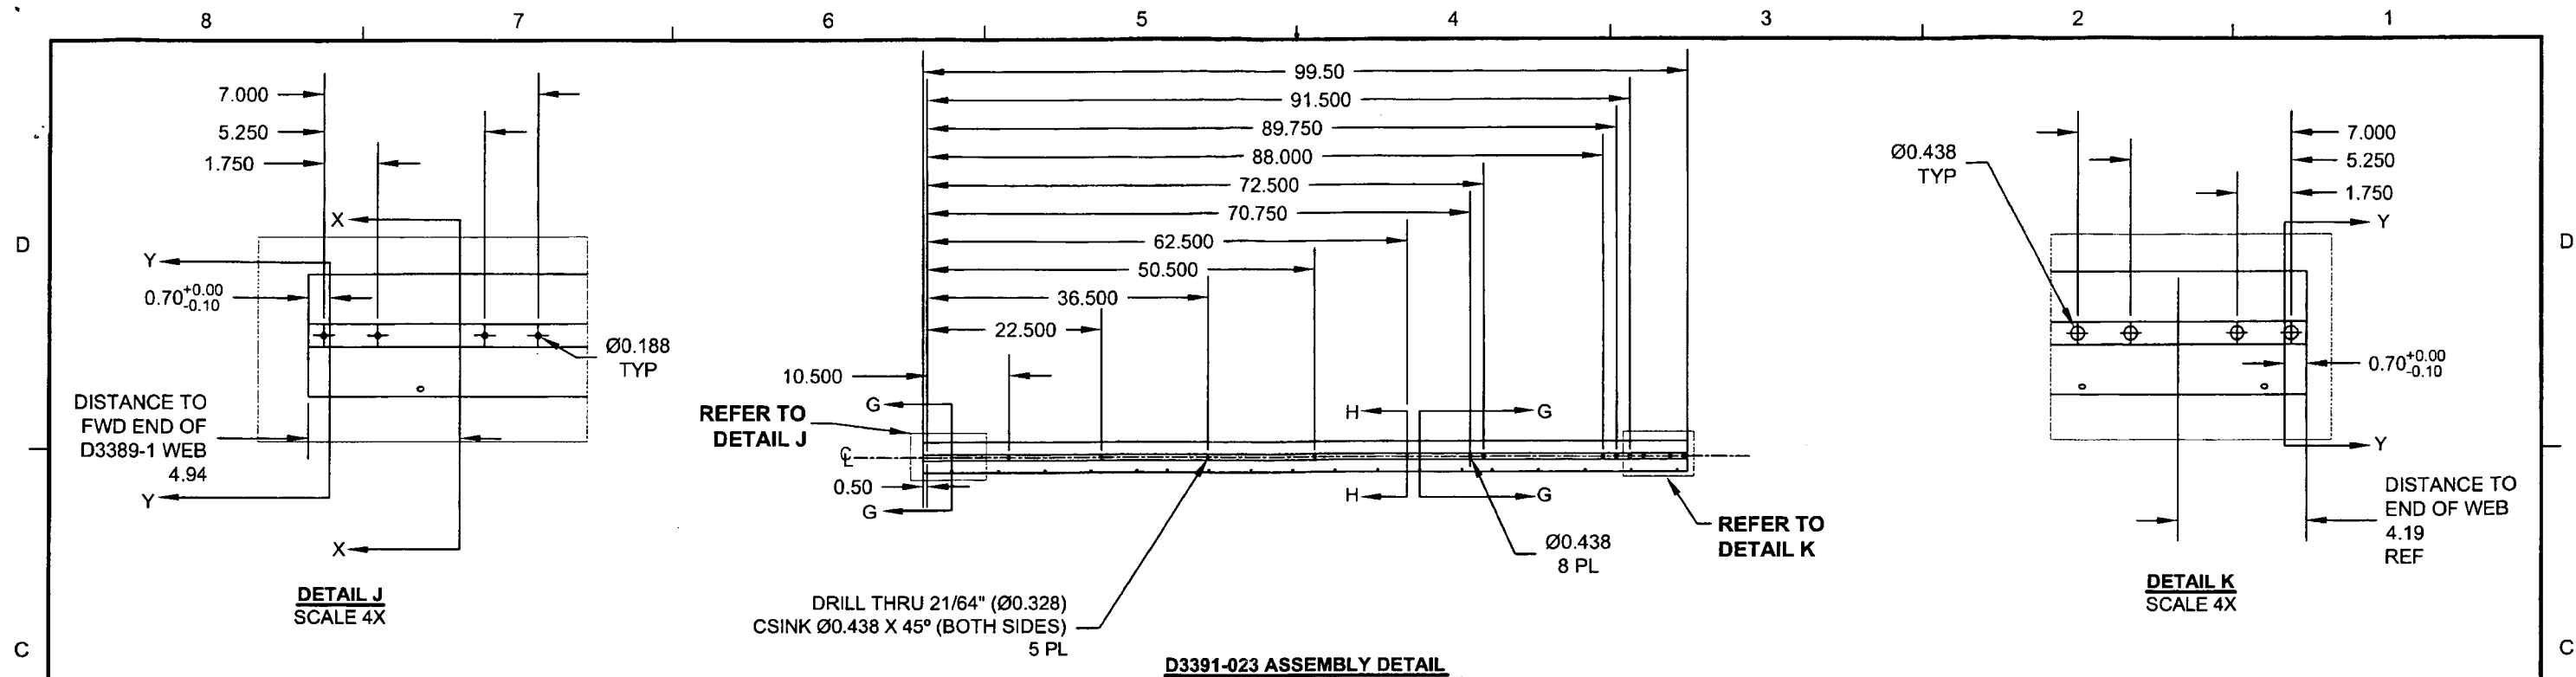


SECTION G-G
SCALE 5X

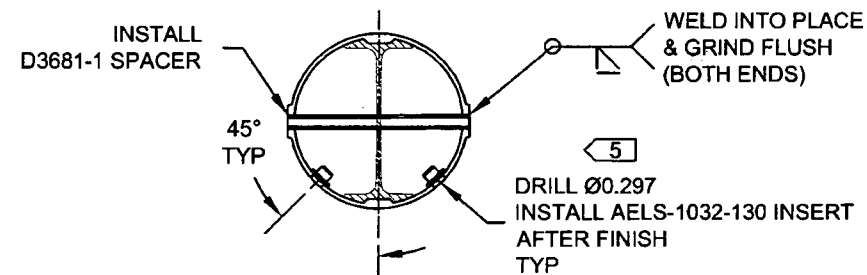

SECTION H-H
SCALE 5X

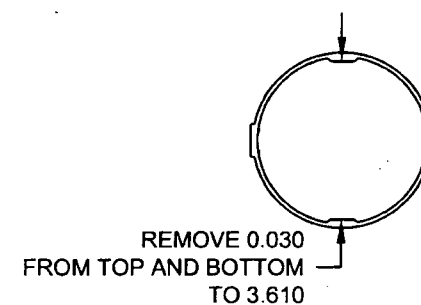

SECTION X-X
SCALE 5X

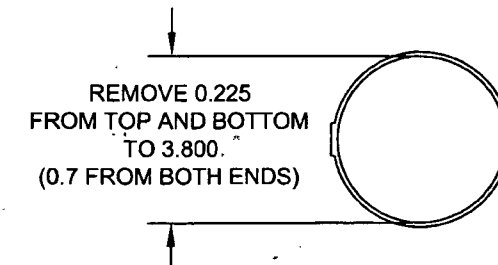

SECTION Y-Y
SCALE 5X

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 44012

RELEASED
08-29-05-14


D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT


D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

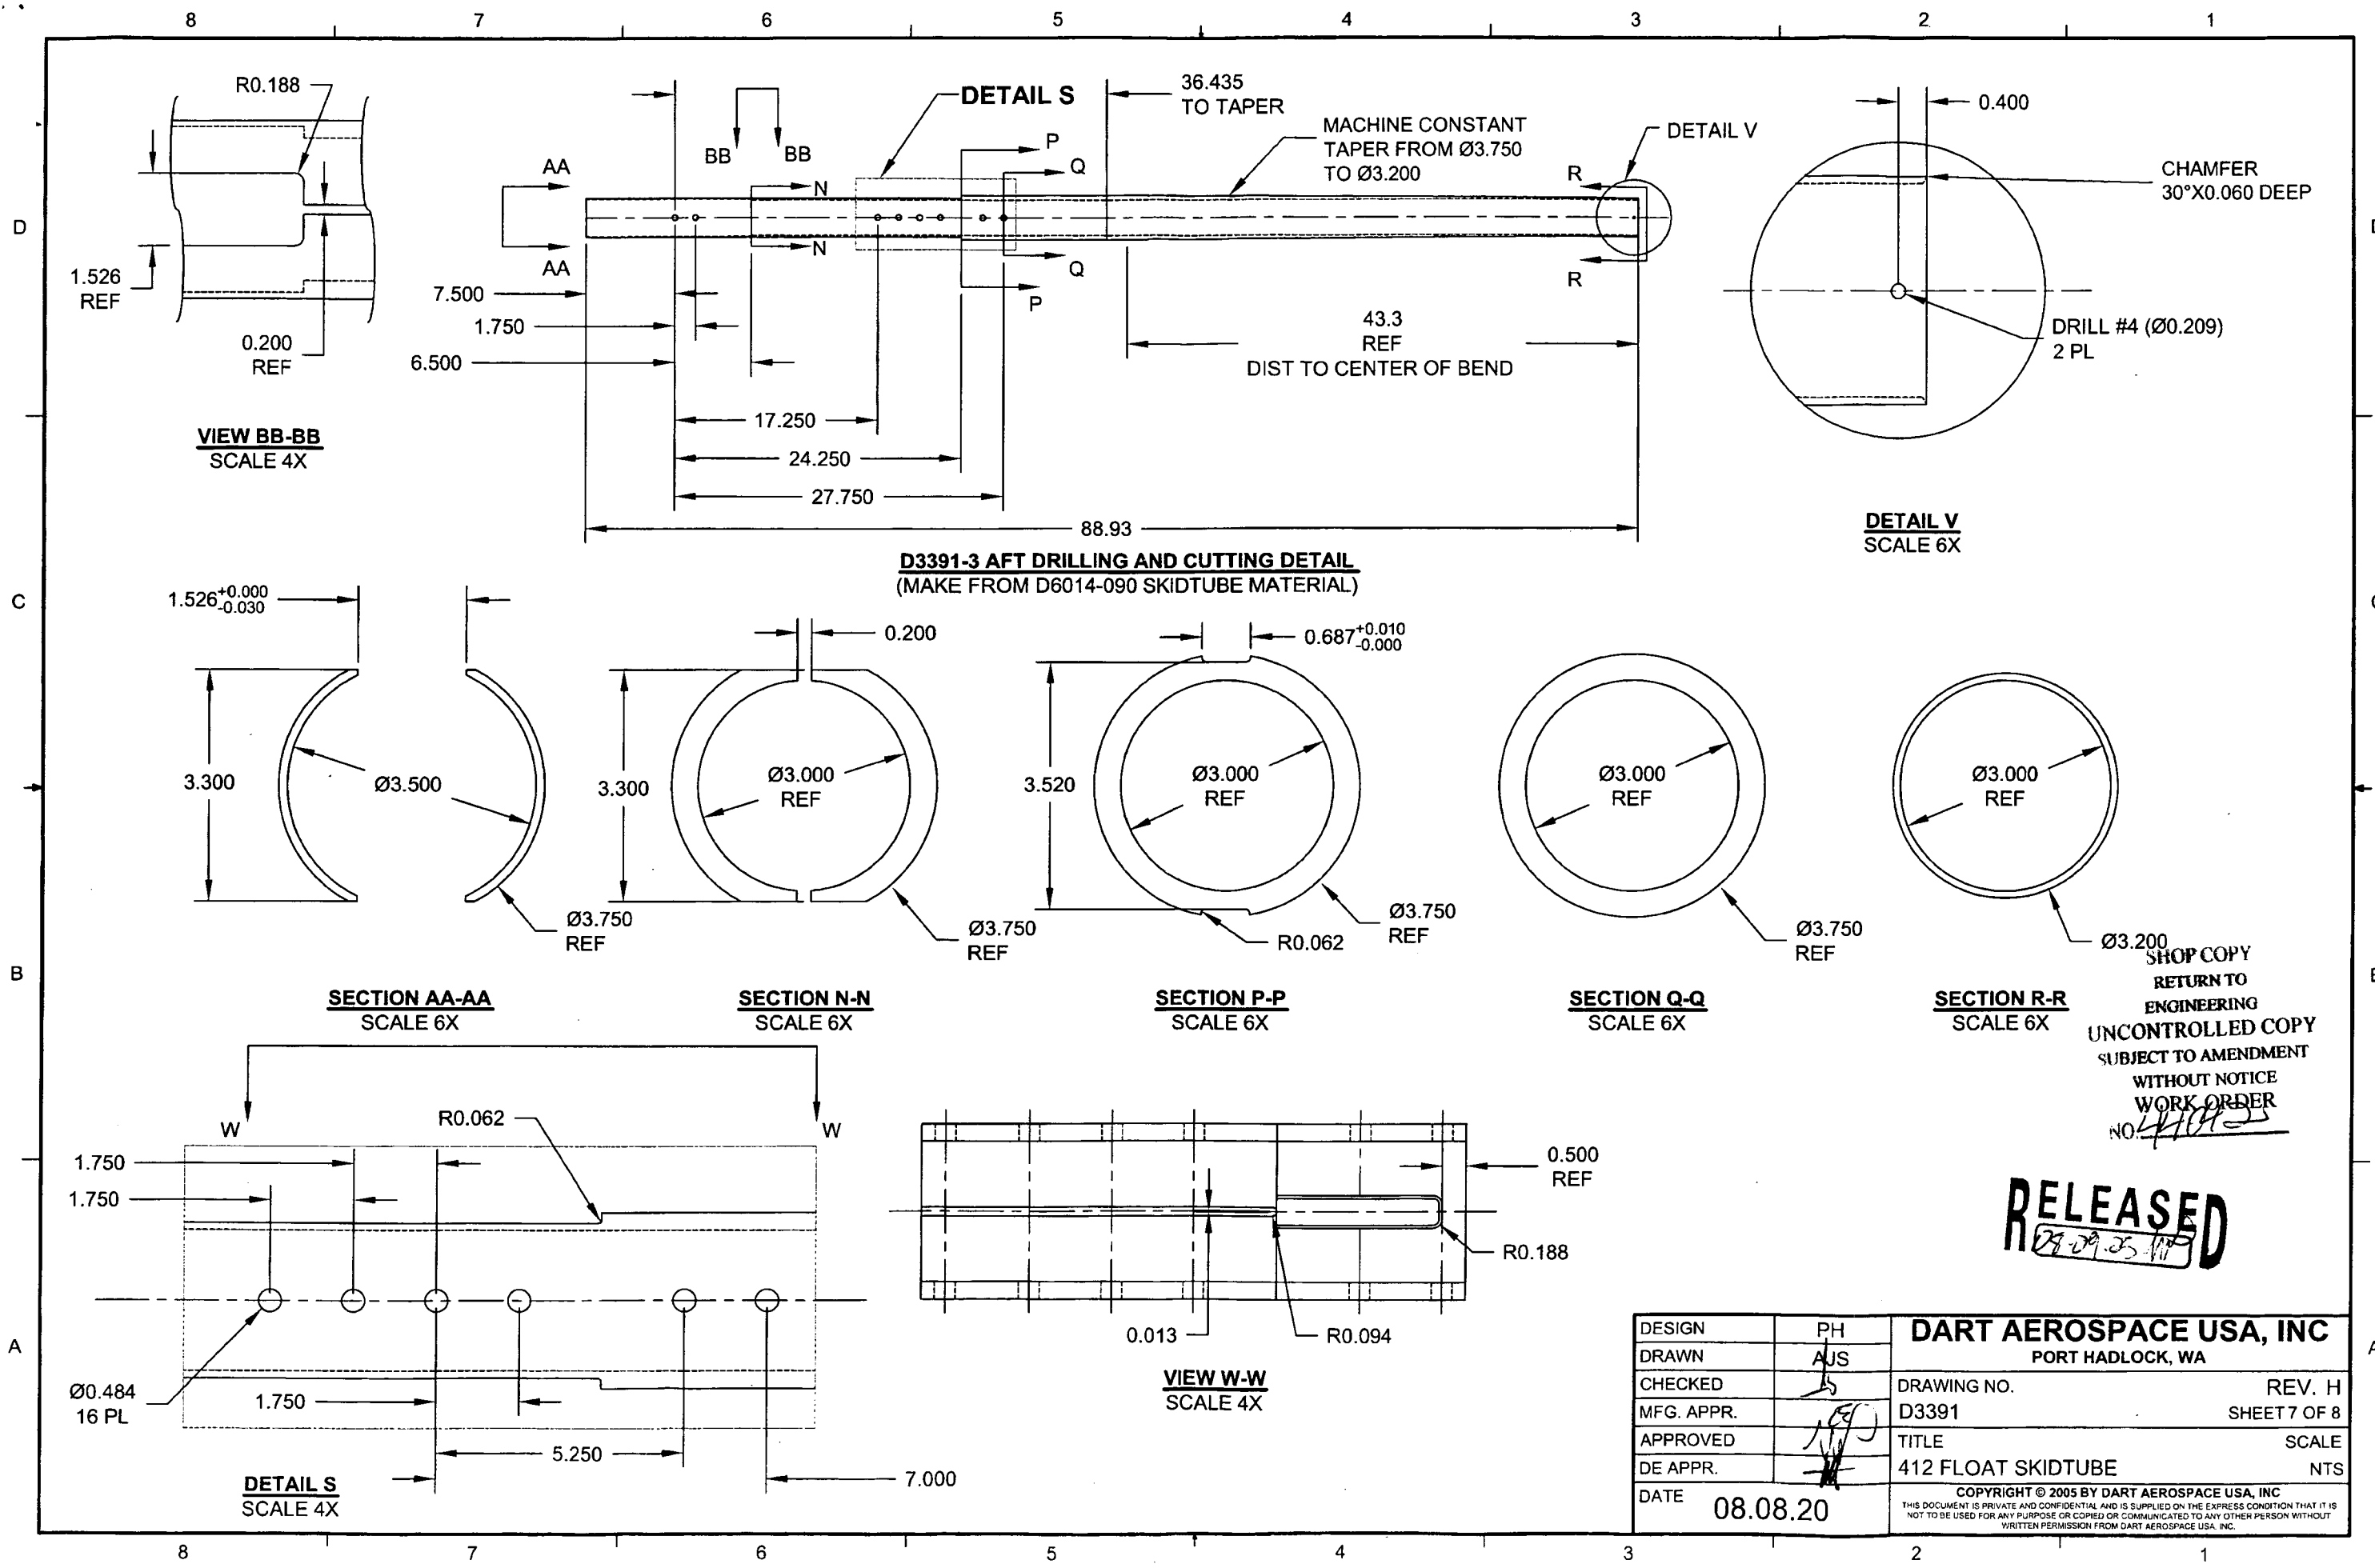


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 44109-25

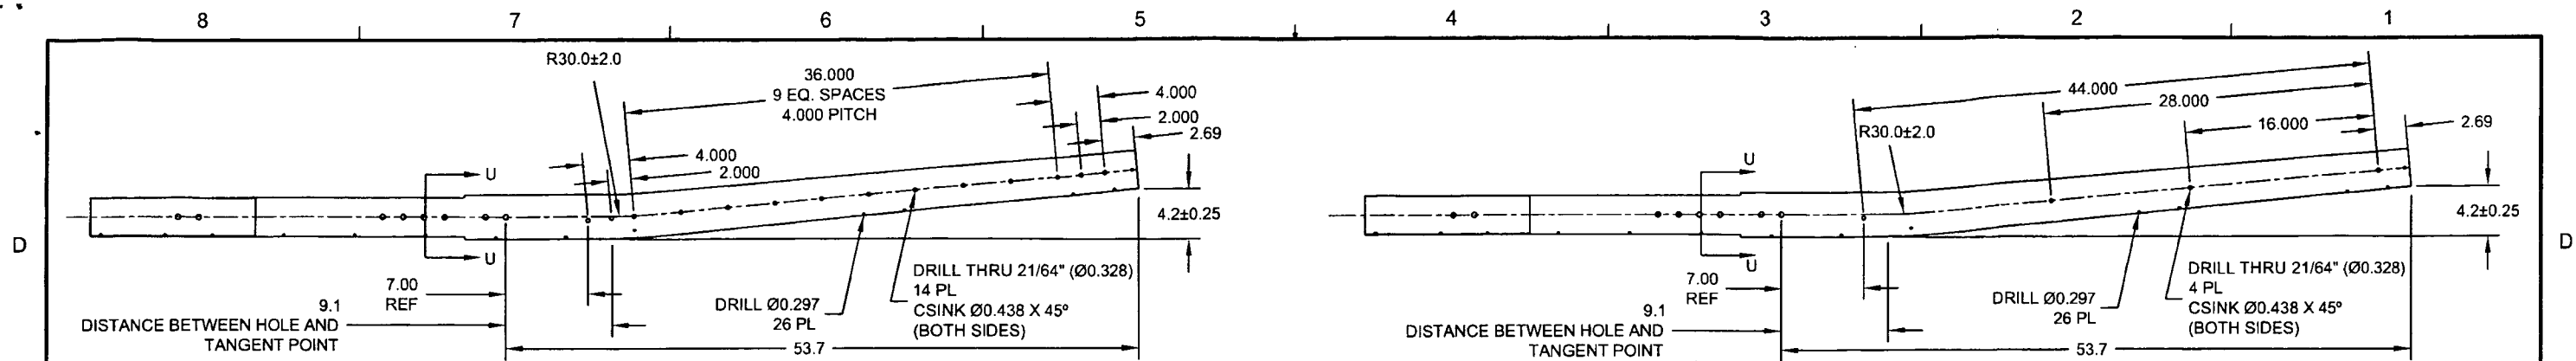


D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

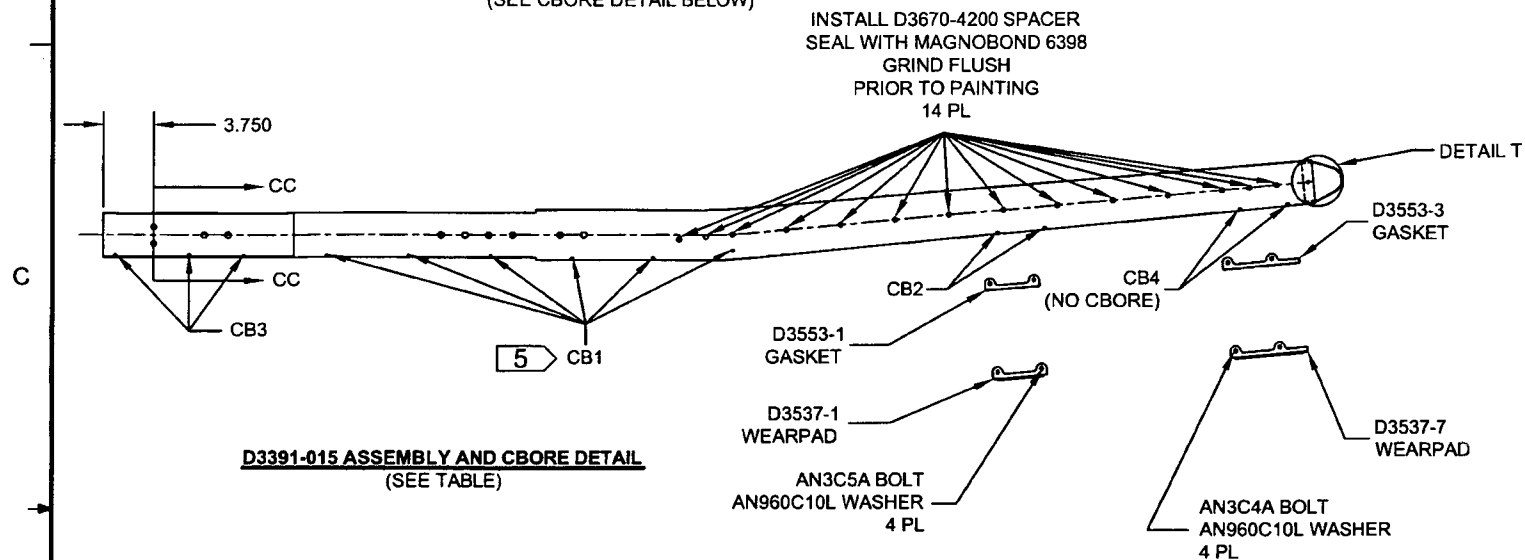


D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

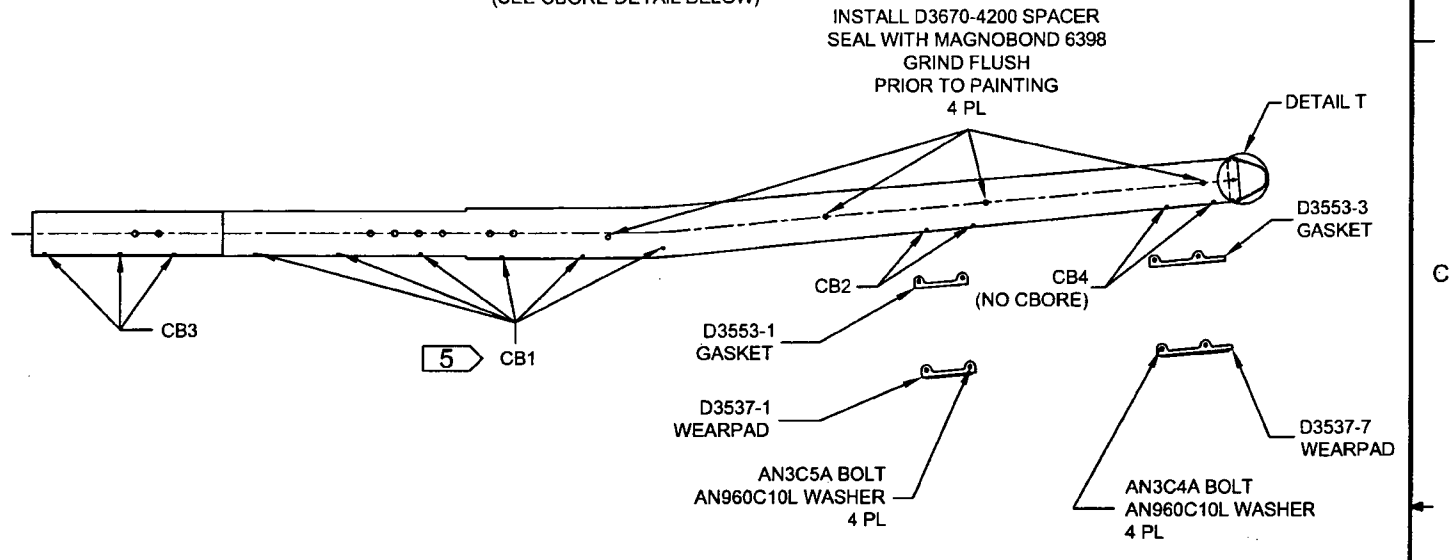


D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

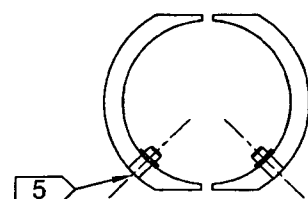


SECTION U-U
SCALE 3X

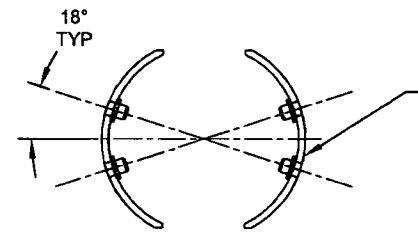

SECTION CC-CC
SCALE 3X

DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

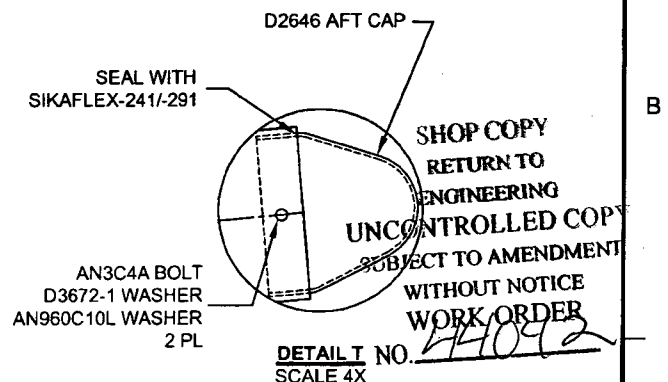

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

RELEASED
08-09-05-148

NO. 174

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 41748
Part number: D339 1023
Description: Mid tube
Welding Process: Tig ☒ Mig ☐
Base material: Aluminium
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual: pass ☒ fail ☐
Penetration: pass ☒ fail ☐

UNACCEPTABLE

Cracks: pass ☒ fail ☐
Undercut: pass ☒ fail ☐
Pin holes: pass ☒ fail ☐
Overlap (cold lap): pass ☒ fail ☐
Porosity (surface): pass ☒ fail ☐
Coloration: pass ☒ fail ☐

Qualifier Det. Dural. Date of Test Coupon 080924
Welder Barclay Elliott Date of Test Coupon 08-09-24

The above named individual is qualified in accordance with AWS D17.1.2001 to weld